EB00921

MPC574xP Default Configuration Update

Rev. 3.0 — 22 April 2025

Technical note

1 Introduction

This document describes updates for the following default configuration:

- Voltage detectors
- · Clock dividers update for the startup self-test
- · Utest flash content
- · ADC threshold register value

2 Voltage detector

2.1 Description of the update

The core Cold voltage detector is disabled on the new device by updating the internal PMC_REE DCF Record.

Table 1. Voltage detector registers reset value update

Register name	Old value	New value
Reset Event Enable 0 (PMC_REE_0)	0000_7C98h	0000_7C90h
Reset Event Selection 0 (PMC_RES_0)	0000_0000h	0000_0008h

2.2 Reason

The reason for this update was because of the issue described in Errata ERR050129: PMC: VDD_LV_CORE is close to the Cold LVD threshold during the device startup.

Errata description:

When the internal regulator is used the VDD_LV_CORE may be up to 50 mV lower than nominal value when device leave the reset. This is caused by the oscillation on the reference voltage of the Power Management Controller (PMC) which is originated by internal coupling. When there is high current transient on IDD_LV during application start, VDD_LV_CORE drop can occur. Together with lower value of VDD_LV_CORE the Cold Low voltage detector (LVD) can be triggered and generates Destructive reset.

2.3 On which devices this change is implemented

This change is implemented on all the devices WW45 (144LQFP) and WW47 (257MAPBGA) 2022 onwards. If you are not sure the datecode (week) of your product, this change was implemented on all devices which have different value than 0xFFFF_FFFF at address 0x0040_00F0 in utest flash.

3 Clock dividers update for the startup self-test

3.1 Description of the update

The clock dividers which were programmed to divide by 2 for the startup self-test were changed to divide by 3.



MPC574xP Default Configuration Update

3.2 Reason

The reason for this update was because of the issue described in the Errata ERR010639: MC_CGM: Auxiliary clock dividers get stuck if programmed to divide by 2 and a reset occurs during operation.

Errata Description:

When any functional reset or destructive reset (besides EXT_POR_B and power on/off) occurs during operation, any auxiliary clock divider in the Clock Generation Module (CGM) that is programmed to divide by 2 and is not sourced by the Internal RC Oscillator (IRCOSC) may get stuck and cannot subsequently be reprogrammed. AUX0_DIV2, AUX1_DIV0, AUX1_DIV1 and AUX11_DIV0 dividers can also stuck during Startup self-test where they are programmed to divide by 2 by internal DCF record which cause LBIST2/3 fail.

3.3 On which devices this change is implemented

This change is implemented on all the devices WW45 (144LQFP) and WW47 (257MAPBGA) 2022 onwards. If you are not sure the datecode (week) of your product, this change was implemented on all devices which have different value than 0xFFFF_FFFF at address 0x0040_00F0 in utest flash.

4 Utest flash content

4.1 Description of the update

Storing the LVD trimming values into the utest flash memory on the address range 0x0040_00F0 – 0x0040_00FB.

4.2 Reason

The reason for this update is the possible usage of the PMC_LVD_MISC DCF record for configuration the temperature sensor reaction because this record configure together with the temperature sensor reaction also the LVD trimming values.

Table 2. utest flash memory content update

utest flash memory range	Old value	New value
0x0040_00F0 - 0x0040_00F3	0xFFFF_FFFF	direct values of the LVDs trimming
0x0040_00F4 - 0x0040_00F7	0xFFFF_FFFF	inverted values of the LVDs trimming
0x0040_00F8 - 0x0040_00FB	0xFFFF_FFFF	1 bit right rotated LVDs trimming

4.3 On which devices this change is implemented

This change is implemented on all the devices WW45 (144LQFP) and WW47 (257MAPBGA) 2022 onwards. If you are not sure the datecode (week) of your product, this change was implemented on all devices which have different value than 0xFFFF_FFFF at address 0x0040_00F0 in utest flash.

4.4 How the temperature sensor DCF record should be programmed

The PMC_LVD_MISC DCF record which programs the temperature sensor reset reaction and LVD trimming values are triple voting DCF record. It means that it is programmed by three record where the first content is the direct data, second is the inverted data and the third one is the rotated data. This is the reason why LVD trimming values are stored in this format in the utest flash. By default the temperature sensor reset reaction are disabled.

EB00921

All information provided in this document is subject to legal disclaimers.

© 2025 NXP B.V. All rights reserved.


MPC574xP Default Configuration Update

EB00921 All information provided in this document is subject to legal disclaimers. © 2024 NXP B.V. All rights reserved.

Table 3. PMC_LVD_MISC DCF record description

PMC_LVD_MISC DCF record	DCF data	DCF control word
Direct	0bRRRT_TTRR_LLLL_LLLL_LLLL_LLLL_LLLLL *[1][1]	0x0040_0144
Negative	0brrr_ttrr_ _ _ _ ^{*[1]}	0x0040_0148
Rotate	0bLRRR_TTTR_RLLL_LLLL_LLLL_LLLL_LLLLL* ¹	0x0040_0150

[1] R – Reserved, T – Temperature sensors configuration, L – LVD trimming value; the small letters mean negation bits of the capital ones.

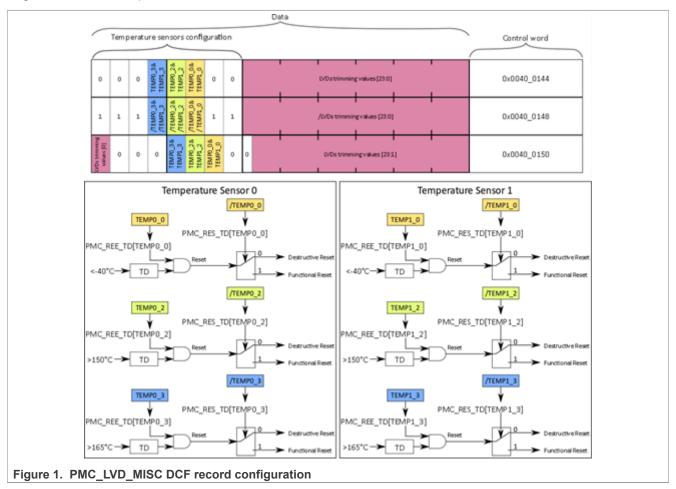

4.5 Example of the PMC_LVD_MISC DCF record configuration

The following example will enable the destructive reset reaction for both temperature sensors for cold (-40 deg) and hot (150 deg) detectors.

1. Create direct DCF record:

MPC574xP Default Configuration Update

Table 4. Example of the DCF configuration

PMC_LVD_MISC DCF record	Temperature sensors configuration ^[1]	LVD trimming values ^[2]	DCF record data ^[3]
direct	0x0C	0x23_4567	0x0C23_4567

- 1. Temperature sensors configuration = 0x0C for destructive reset reaction for both temperature sensors for cold (-40 deg) and hot (150 deg) detectors.
- 2. Read direct LVD trimming values [23:0] from utest flash memory 0x0040 00F1 0x0040 00F3.
- 3. Direct DCF record = (Temperature sensors configuration << 24)| LVD trimming values = (0x0C << 24) | 0x23 4567 = 0x0C23 4567
- 4. Negative DCF record = NOT (direct DCF record) = NOT (0x0C23 4567) = 0xF3DC BA98
- 5. Rotate DCF record = ROTATE_RIGHT_ONE_BIT (direct DCF record) = ROTATE_RIGHT_ONE_BIT (0x0C23_4567) = 0x8611_A2B3
- 6. Program following DCF records into the utest flash memory DCF records area: 0x0C23_4567_0040_0144, 0xF3DC_BA98_0040_0148, 0x8611_A2B3_0040_0150.

5 ADC threshold register value

5.1 Description of the update

The default threshold values for capacitive self test (algorithm C step 0) stored in the Self Test Analog Watchdog Register 4 (STAW4R) was changed by updating the ADC self test threshold values in the utest flash.

Table 5. STAW4R register value update

Update staff	Old value	New value
Address 0x0040_00E4	0xF010_FFF0	0xF034_FFCC
Register ADC_STAW4R	0x0010_0FF0	0x0034_0FCC

5.2 Reason

The original thresholds values (+/- 16) were derived from the measurement in clean environment. However, in the real application there is noise caused by board, power supply and other factors. Therefore, the thresholds values were changed to +/-52 to pass the ADC self test in real application where the MCU is used.

The test are carried for both the thresholds +/-16 and +/-52, so the devices with the new DCF record (ADC STAW4R default value) will be tested same as in the past. It also passes the self test in the noisy (real) environment.

5.3 On which devices this change is implemented

This change is implemented on all the devices WW45 (144LQFP) and WW47 (257MAPBGA) 2022 onwards. If you are not sure the datecode (week) of your product, this new threshold values were implemented there when ADC_STAW4R register reset value is 0x0034_0FCC.

6 Revision history

Table 6. Revision history

Revision Number	Release Date	Changes
3	<u> </u>	Changed the title of the document from "Time-Frequency Domain Thresholding

00921 All information provided in this document is subject to legal disclaimers.

© 2025 NXP B.V. All rights reserved

MPC574xP Default Configuration Update

Table 6. Revision history...continued

Revision Number	Release Date	Changes
		(TFDT) Library Function" to "MPC574x P Default Configuration Update".
2	11 January 2024	Updated the text in the following sections: • On which devices this change isimplemented • On which devices this change isimplemented
1	06 June 2021	Initial release

MPC574xP Default Configuration Update

Legal information

Definitions

Draft — A draft status on a document indicates that the content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included in a draft version of a document and shall have no liability for the consequences of use of such information.

Disclaimers

Limited warranty and liability — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms and conditions of commercial sale of NXP Semiconductors.

Right to make changes — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

Suitability for use — NXP Semiconductors products are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or malfunction of an NXP Semiconductors product can reasonably be expected to result in personal injury, death or severe property or environmental damage. NXP Semiconductors and its suppliers accept no liability for inclusion and/or use of NXP Semiconductors products in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk

Applications — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

Terms and conditions of commercial sale — NXP Semiconductors products are sold subject to the general terms and conditions of commercial sale, as published at https://www.nxp.com/profile/terms, unless otherwise agreed in a valid written individual agreement. In case an individual agreement is concluded only the terms and conditions of the respective agreement shall apply. NXP Semiconductors hereby expressly objects to applying the customer's general terms and conditions with regard to the purchase of NXP Semiconductors products by customer.

Export control — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

Suitability for use in non-automotive qualified products — Unless this document expressly states that this specific NXP Semiconductors product is automotive qualified, the product is not suitable for automotive use. It is neither qualified nor tested in accordance with automotive testing or application requirements. NXP Semiconductors accepts no liability for inclusion and/or use of non-automotive qualified products in automotive equipment or applications.

In the event that customer uses the product for design-in and use in automotive applications to automotive specifications and standards, customer (a) shall use the product without NXP Semiconductors' warranty of the product for such automotive applications, use and specifications, and (b) whenever customer uses the product for automotive applications beyond NXP Semiconductors' specifications such use shall be solely at customer's own risk, and (c) customer fully indemnifies NXP Semiconductors for any liability, damages or failed product claims resulting from customer design and use of the product for automotive applications beyond NXP Semiconductors' standard warranty and NXP Semiconductors' product specifications.

HTML publications — An HTML version, if available, of this document is provided as a courtesy. Definitive information is contained in the applicable document in PDF format. If there is a discrepancy between the HTML document and the PDF document, the PDF document has priority.

Translations — A non-English (translated) version of a document, including the legal information in that document, is for reference only. The English version shall prevail in case of any discrepancy between the translated and English versions.

Security — Customer understands that all NXP products may be subject to unidentified vulnerabilities or may support established security standards or specifications with known limitations. Customer is responsible for the design and operation of its applications and products throughout their lifecycles to reduce the effect of these vulnerabilities on customer's applications and products. Customer's responsibility also extends to other open and/or proprietary technologies supported by NXP products for use in customer's applications. NXP accepts no liability for any vulnerability. Customer should regularly check security updates from NXP and follow up appropriately. Customer shall select products with security features that best meet rules, regulations, and standards of the intended application and make the ultimate design decisions regarding its products and is solely responsible for compliance with all legal, regulatory, and security related requirements concerning its products, regardless of any information or support that may be provided by NXP.

NXP has a Product Security Incident Response Team (PSIRT) (reachable at PSIRT@nxp.com) that manages the investigation, reporting, and solution release to security vulnerabilities of NXP products.

NXP B.V. — NXP B.V. is not an operating company and it does not distribute or sell products.

Trademarks

Notice: All referenced brands, product names, service names, and trademarks are the property of their respective owners.

NXP — wordmark and logo are trademarks of NXP B.V.

EB00921

MPC574xP Default Configuration Update

Contents

1	Introduction	1
2	Voltage detector	1
2.1	Description of the update	1
2.2	Reason	1
2.3	On which devices this change is	
	implemented	1
3	Clock dividers update for the startup	
	self-test	1
3.1	Description of the update	
3.2	Reason	
3.3	On which devices this change is	
	implemented	2
4	Utest flash content	
4.1	Description of the update	2
4.2	Reason	
4.3	On which devices this change is	
	implemented	2
4.4	How the temperature sensor DCF record	
	should be programmed	2
4.5	Example of the PMC_LVD_MISC DCF	
	record configuration	3
5	ADC threshold register value	
5.1	Description of the update	
5.2	Reason	
5.3	On which devices this change is	
	implemented	4
6	Revision history	
-	Legal information	
	• • • • • • • • • • • • • • • • • • •	

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.